

BULLETIN NO: 08 - 80



DATE: November 10, 1980.

SUBJECT: CR-2020

Problem: Power switch failure.

Cause: Pitting and burning of switch contact due to high current spike when set is switched off. (Back E.M.F. from power transformer).

Remedy: Replace power on/off switch (KA200630).
Install a jumper wire between the fuse holder (white wire) and the switched AC outlet (red wire).

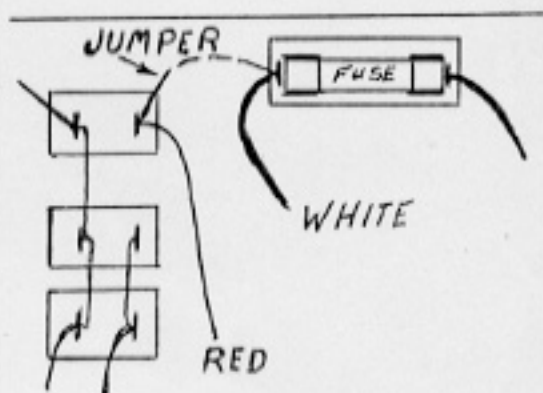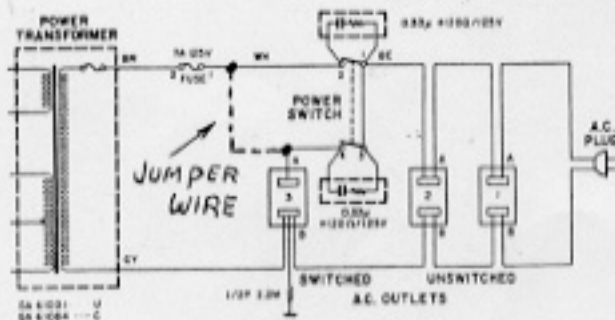

Install the jumper wire on all units received for service that have not been modified.